


**Product Type** Single Dryer, Tumble Dryer, Topload Washer, Frontload Washer, Cabinet Hardmount Washer-Extractor (\*C Models)  
**Purpose** Service Procedure  
**Interchangeable** N/A  
**Subject** Coin Drop Not Accepting U.S. Quarters

---

Mechanical coin drops, Part No. 70441601P, not accepting U.S. quarters can be caused by a small casting burr on two areas of the coin drop causing the quarter to be rejected. The small casting burr prohibits both the weight and anti-string pendulum from freely moving.

To correct, remove drop from unit. The slight burr can be removed by applying side to side pressure on the pivot joint while working the part in a back and forth motion. Add one drop of PTFE (such as Teflon™) lubricant and work the lubricant into the joint area. Bench test the drop by inserting quarters to test the operation. Reinstall the coin drop.

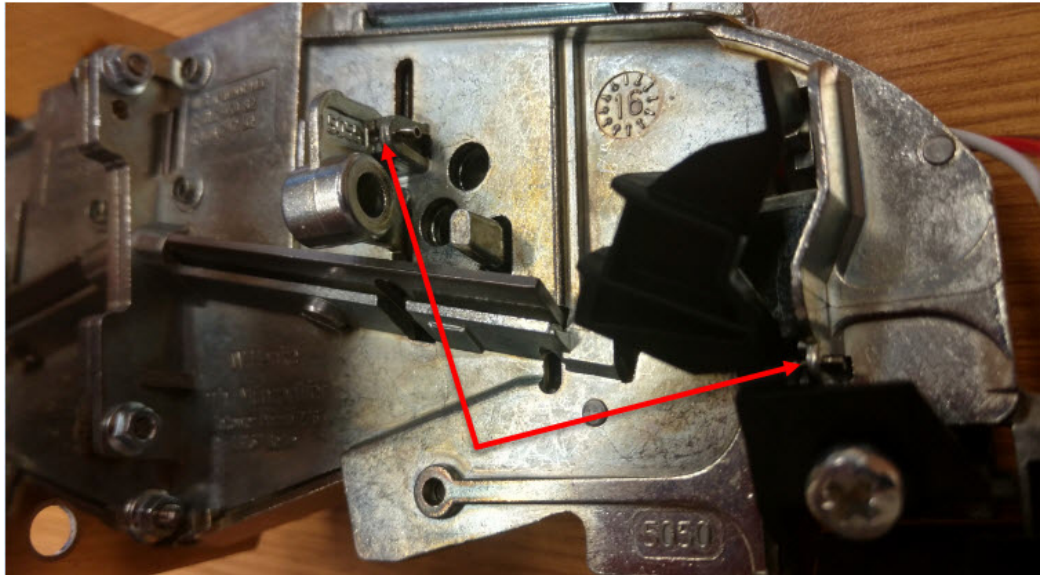

TLW1881B

Figure 1